## APPLICATION



If contaminated, use a clay bar to clean. If paint correction is required, do so before application.



Wash and completely dry surfaces to be coated.



Clean the paint using a 50% IPA (isopropyl alcohol) to water mix in a trigger sprayer. Mist the paint then wipe down with a microfiber towel.



Wipe on coating by hand using a sponge or coating block, piece by piece. After wiping on wait 30-90 seconds to flash (depending on temp) then buff off with a microfiber towel.

Wait 20 minutes before driving, and 6 hours before getting wet.




## **PRODUCT OVERVIEW**

etary ceramic technology, Crystal is a high performer against friction, heat, and solvent.

## **TECHNICAL DATA**

EFFECTIVENESS	3 years depending
PENCIL HARDNESS	9H
APPLICATION	Wipe on / buff off a
BOTTLE SIZE	65mL, 275mL, 4L
SHELF TIME	18 months from sh
APPEARANCE	Clear / High Gloss
FILM THICKNESS	0.2 mil
CHEM. RESISTANCE	Very Good
TEMP. RESISTANCE	> 538°C (1000°F)
SALT SPRAY	-
ADHESION CROSS-CUT TAPE	(ASTM D3359) 5b (0
MANDREL BEND	(ASTM D522) 0% @
ІМРАСТ	-
COVERAGE	200 sq feet (18.6m)
DRY TIME	20 minutes
CURE TIME	Initial cure in 4 hou
UV PROTECTION	Yes



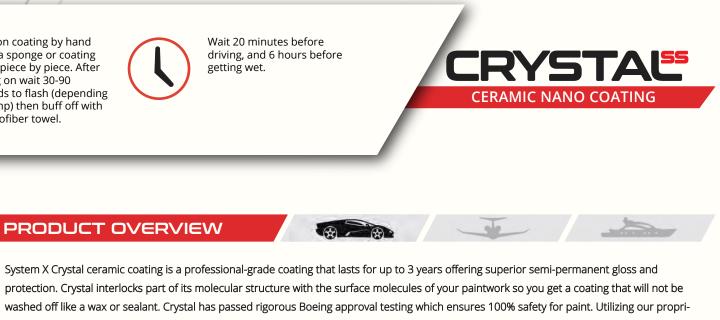

on environmental factors

application or use HVLP gun with 0.8mm tip and buff off by hand

hipment date when unopened and stored dry at 13°C (55°F) to 29°C (85°F)

(0%, none)

@ 180° rotation

n2) per 100mL

ours, full cure in 3 days